

P0011

Adjustment of Inlet Camshaft in relation to Crankshaft, Bank 1 – Signal Implausible

Diagnostic conditions

- Battery voltage between 10 V and 16 V
- Time after the engine is started longer than 10 seconds
- Engine oil temperature between -9°C and 100°C
- Engine speed between 1,160 rpm and 6,000 rpm.

Possible cause of fault

- ◆ Dirt in oil circuit
- ◆ Sealing strips on inlet camshaft adjuster faulty
- ◆ Oil pressure too low
- ◆ Mechanical fault in inlet camshaft adjuster
- ◆ Solenoid hydraulic valve faulty

Affected pins

-

Diagnosis/troubleshooting



Note!

The fault P0011 is only recorded if the actual value deviates from the nominal value by between 5 °NW and 14 °NW in a space of 2 to 5 seconds.

Work instruction			Display OK	If not OK
1	Read out fault memory	◆ Check whether additional faults have been recorded	Only fault P0011 was recorded ⇒ Step 3	Fault P0021 was also recorded in the DME control module ⇒ Step 2
2	Check oil pressure, oil pump, pressure-regulating valve and oil type		⇒ Continue troubleshooting in Engine Workshop Manual ⇒ 1; Rep. Gr. 17; Engine - lubrication → End	
3	Check magnetic hydraulic valve for leaks, check sealing strips on camshaft adjuster and camshaft adjuster itself for damage and check camshaft adjustment oil circuit for leaks and blockage		⇒ Continue troubleshooting in Workshop Manual ⇒ Group 1; Rep. Gr. 15; Engine, cylinder head, valve drive → End	

